


RD 0817 and RD 2103 - City of Wheatland




	System: RD 817 and RD 2103 City of Wheatland System Rating: Unacceptable Approved SWIF / LOI: No PL 84-99 RP Eligibility: Inactive	ALD HAST	Castin Lint Line C	Treek CARN LINE AREA .	diverted the state of the state	July Frent July Frent Victory Light Library Control of State of St
ra	Operations and Maintenance Manuals	141	М	Μ	М	
General	Emergency Supplies and Equipment	Α	Α	Α	A	
	Flood Preparedness and Training	M	M	M	M	
66-	Encroachments Closure Structures	U N/A	M N/A	U N/A	U NI/A	
ee - Items ing PL 84 Eligibility	Slope Stability	N/A M	N/A M	N/A U	N/A M	
- Ite Pibi	Erosion/Bank Caving	M	A	M	M	
Levee - Items Affecting PL 84-99 RP Eligibility	Animal Control	M	M	M	M	
Leve fecti RP I	Culverts/Discharge Pipes	N/A	N/A	N/A	N/A	
Af	Underseepage Relief Wells/Toe Drainage Systems	N/A	N/A	M	N/A	
i,	Vegetation Growth	M	M	M	M	
en t	Sod Cover	Α	М	Α	М	
e Embankme Other Items	Settlement	Μ	М	М	M	
an- te	Depressions/Rutting	U	Ü	M	M	
imb her	Cracking	Α	A	Α	Α	
g e E	Riprap Revetments & Bank Protection	M	N/A	M	M	
Levee Embankments - Other Items	Revetments other than Riprap	N/A	N/A	N/A	N/A	
	Seepage	M	Α	Α	Α	
	Legend A Acceptable M Minimally Acceptable U Unacceptable N/A Not Applicable RP Rehabilitation Program (Note: flood fight as:	M U U sistance avai	event Serious de establishe Likely prev	ficiency note d timeframe ents perforr	ed in past ins	is not likely to prevent performance in next floo spection report has not been corrected within that It flood event



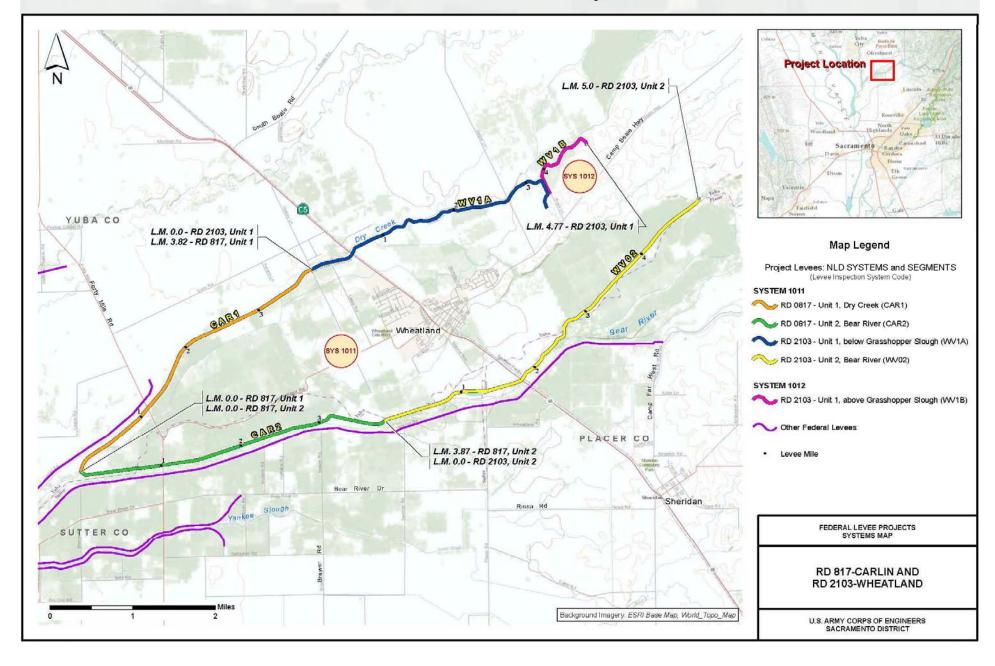

RD 2103 - Grasshopper Slough

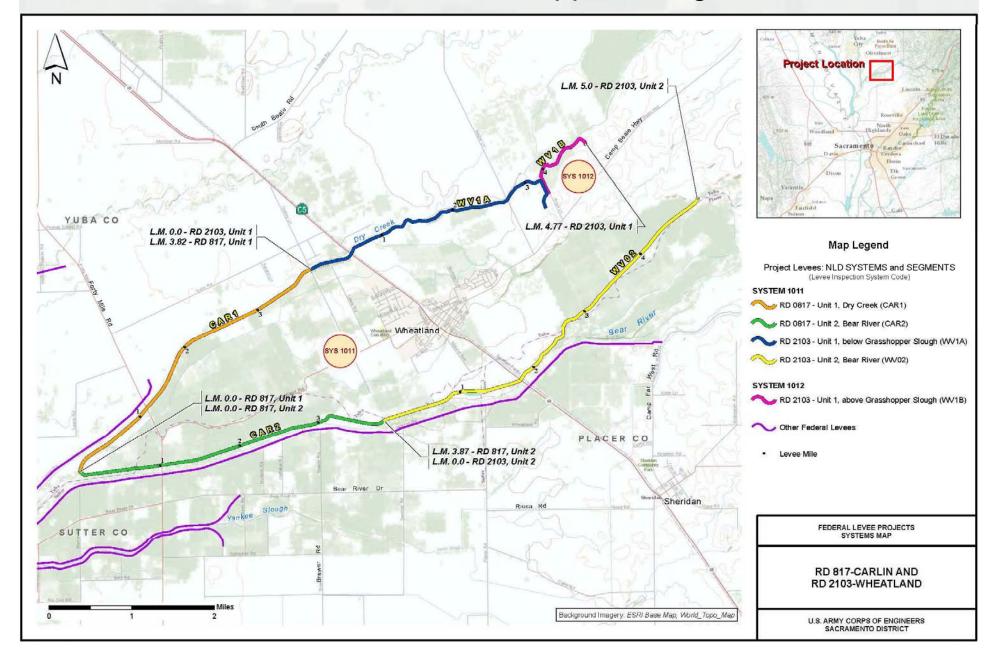


Levee Embankments - Affecting PL 84-99 General Other Items RP Eligibility	System: RD 2103 Grasshopper Slough System Rating: Unacceptable Approved SWIF / LOI: No PL 84-99 RP Eligibility: Inactive Operations and Maintenance Manuals Emergency Supplies and Equipment Flood Preparedness and Training Encroachments Closure Structures Slope Stability Erosion/Bank Caving Animal Control Culverts/Discharge Pipes Underseepage Relief Wells/Toe Drainage Systems Vegetation Growth Sod Cover Settlement Depressions/Rutting Cracking	M A M M M M N/A N/A N/A M M M M M M M M M M M M M M M M M M M
se Em Oth	Riprap Revetments & Bank Protection	N/A
Lev	Revetments other than Riprap Seepage	N/A A
	Legend A Acceptable M Minimally Acceptable U Unacceptable N/A Not Applicable RP Rehabilitation Program (Note: flood fight as	Includes Unacceptable observations not likely to prevent performance in next flood event Serious deficiency noted in past inspection report has not been corrected within the established timeframe Likely prevents performance in next flood event ssistance available regardless of eligibility status)





RD 0369, RD 0551, RD 0554, and RD 0755 – Pierson District

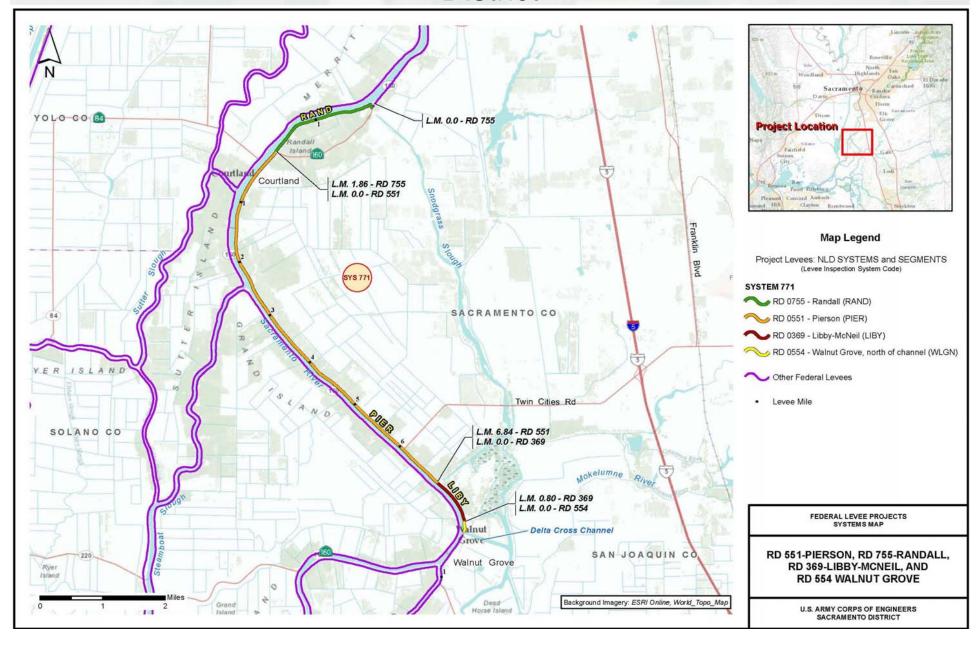


	System: RD 551 and RD 755 Pierson District Levee System System Rating: Unacceptable Approved SWIF / LOI: No PL 84-99 RP Eligibility: Inactive		ROLLINES ROLLING	AD PEST - Priesent Pri	And Thurthe Market	A THE THE LIGHT CENSES			
General	Operations and Maintenance Manuals	М	М	M	М				
ene	Emergency Supplies and Equipment	M	М	M	M				
Ű	Flood Preparedness and Training	M	M	M	M				
66	Encroachments	U	U	U	M				
Levee - Items Affecting PL 84-99 RP Eligibility	Closure Structures	N/A	N/A	N/A	N/A				
Ite PL { ibilli	Slope Stability	Α	Α	Α	Α				
e - ng I	Erosion/Bank Caving	Α	Α	M	Α				
Levee - Items ecting PL 84-' RP Eligibility	Animal Control	M	M	M	M				
Lo Nffe	Culverts/Discharge Pipes	N/A	N/A	N/A	N/A				
-	Underseepage Relief Wells/Toe Drainage Systems	N/A	N/A	N/A	N/A				
- S	Vegetation Growth	M	M	M	M				
ent	Sod Cover	M	M	M	Α				
km	Settlement	M	M	M	M				
oan r Ite	Depressions/Rutting	M	U	Α	Α				
Levee Embankments - Other Items	Cracking	Α	А	A	Α				
g e E	Riprap Revetments & Bank Protection	M	M	N/A	M				
eve	Revetments other than Riprap	N/A	N/A	N/A	N/A				
_=	Seepage	Α	Α	Α	А				
	<u>Legend</u> A Acceptable	M	event			s not likely to prevent performance in next floo spection report has not been corrected within t			
	M Minimally Acceptable	U		d timeframe		r			
	U Unacceptable	U				and Canadamant			
	N/A Not Applicable RP Rehabilitation Program (Note: flood fight as		Likely prevents performance in next flood event vailable regardless of eligibility status)						





RD 0003 - Grand Island

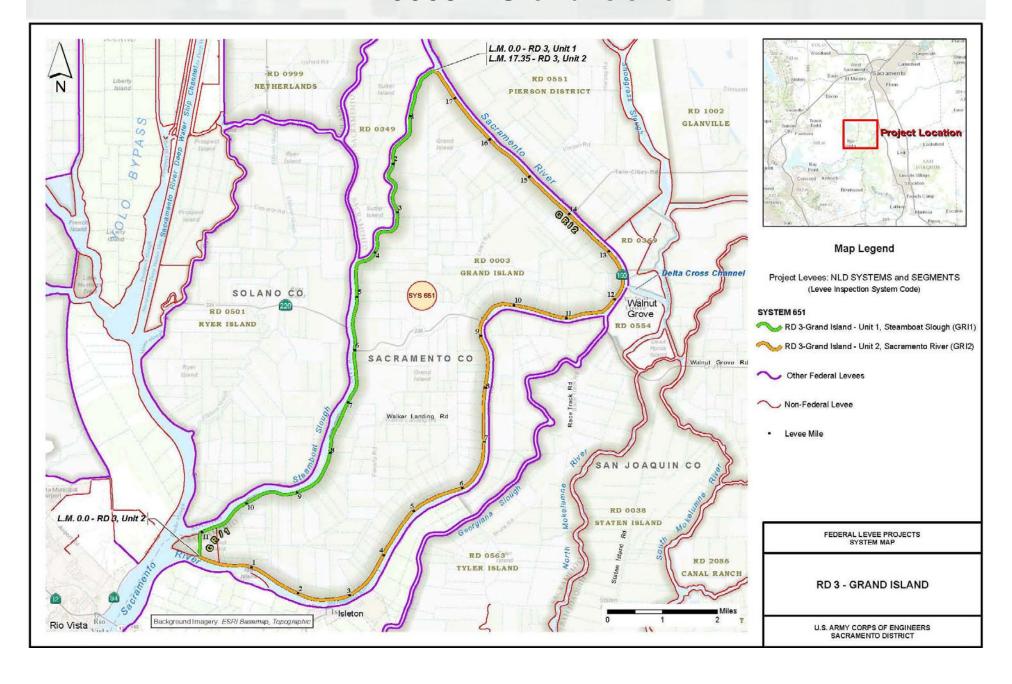


	System: RD 0003 - Grand Island System Rating: Unacceptable Approved SWIF / LOI: No PL 84-99 RP Eligibility:Inactive	\$0 3,7th 630	A A	Storic St					
ral	Operations and Maintenance Manuals	Α	Α						
(I)	Emergency Supplies and Equipment	M	М						
737.9	Flood Preparedness and Training	M	M						
RP	Encroachments	U	U	2					
ns -99	Closure Structures	N/A	N/A						
Iter 84 Iity	Slope Stability	U	U						
(I) ho	Erosion/Bank Caving	U	U						
eve ting Eli	Animal Control	U	U						
fect	Culverts/Discharge Pipes	N/A	N/A						
Afi	Underseepage Relief Wells/Toe Drainage Systems	N/A	N/A						
1_	Vegetation Growth	M	M						
in ts	Sod Cover	U	U						
e Embankme Other Items	Settlement	М	М						
ank Ite	Depressions/Rutting	U	U						
mb her	Cracking	M	U						
Levee Embankments - Other Items	Riprap Revetments & Bank Protection	M	M					43	
eve	Revetments other than Riprap	N/A	N/A						
	Seepage	U	M						
	Legend A Acceptable M Minimally Acceptable U Unacceptable N/A Not Applicable RP Rehabilitation Program (Note: flood fight	M U U assistance ava	Includes Unacceptable observations not likely to prevent performance in next flood event Serious deficiency noted in past inspection report has not been corrected with Likely prevents performance in next flood event available regardless of eligibility status)						







Feather River – Hamilton – Northeast of Afterbay

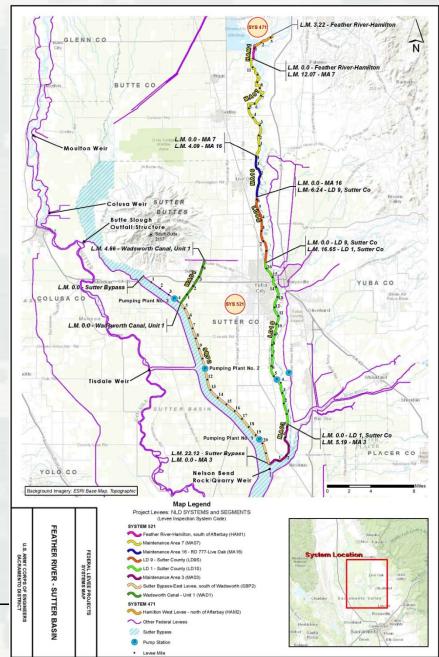




BUILDING STRONG®




	System: Feather River - Hamilton northeast of Afterbay System Rating: Unacceptable Approved SWIF / LOI: No PL 84-99 RP Eligibility: Inactive	Legited State	Hernital Mest Outlon						
General	Operations and Maintenance Manuals	Α							
ene	Emergency Supplies and Equipment	М							
	Flood Preparedness and Training	М							\vdash
6	Encroachments	U							
ms 44-	Closure Structures	N/A				2			-
F He	Slope Stability	М							
ng Elig	Erosion/Bank Caving	U				u			
Levee - Items ecting PL 84-9 RP Eligibility	Animal Control	M				-			-
Levee - Items Affecting PL 84-99 RP Eligibility	Culverts/Discharge Pipes	N/A				20		-	
77.	Underseepage Relief Wells/Toe Drainage Systems	N/A							
<u>iş</u>	Vegetation Growth Sod Cover	M	-			<u> </u>		100	
Jen Si	Settlement	M				-			-
F F	Depressions/Rutting	A U							
bar T	Cracking								
e Embankme Other Items	Riprap Revetments & Bank Protection	A M				9			
₈ ○	Revetments other than Riprap	N/A			-	-		•	1
Levee Embankments - Other Items		M	—			2	2	-	+ +
	Seepage Legend A Acceptable M Minimally Acceptable U Unacceptable N/A Not Applicable RP Rehabilitation Program (Note: flood fight ass	M U	Includes Unac event Serious deficie established tir Likely prevent	ency note meframe s perform	d in past ins	pection repo			



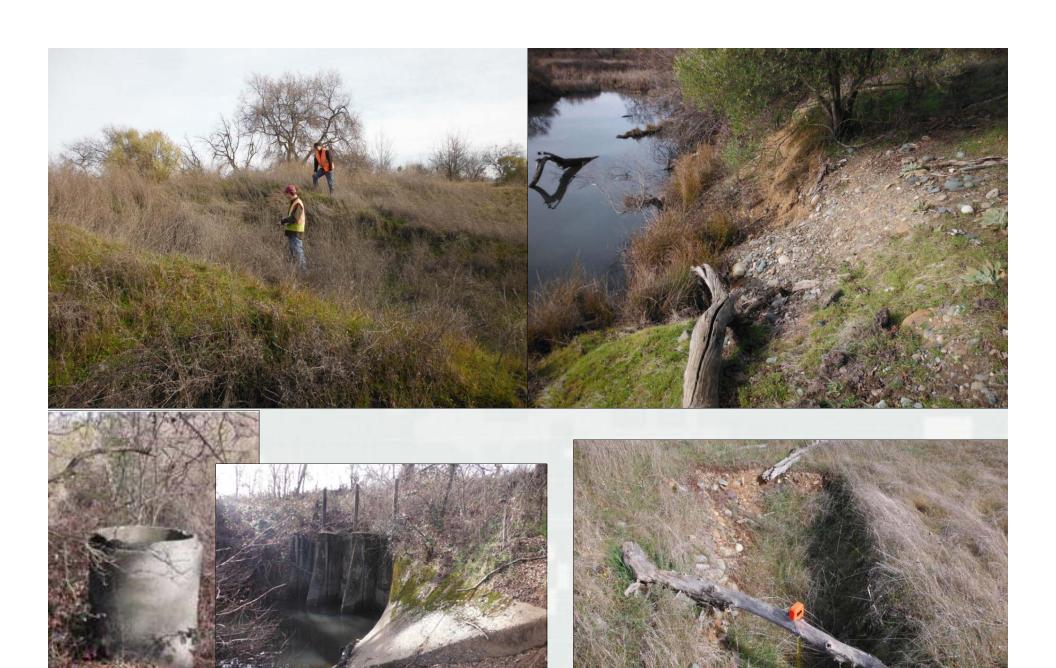

Feather River - Nelson Bend West Levee

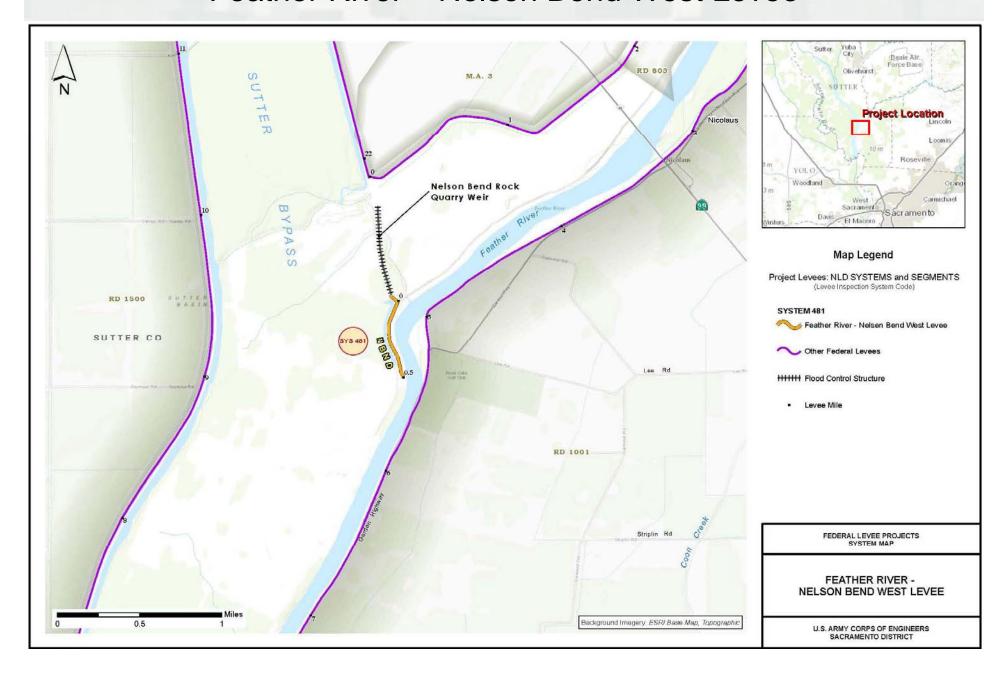


	System: Feather River - Nelson Bend West Levee System Rating: Unacceptable Approved SWIF / LOI: No PL 84-99 RP Eligibility: Inactive	to differ to the last	Helson Bend Mest						
General	Operations and Maintenance Manuals	85.00							
ene	Emergency Supplies and Equipment	M							
	Flood Preparedness and Training	M							
Levee - Items Affecting PL 84-99 RP Eligibility	Encroachments	M							
	Closure Structures	N/A							
H H	Slope Stability	A							
ee- ng Elig	Erosion/Bank Caving Animal Control	Α							
ecti RP	Culverts/Discharge Pipes	U N/A	ł				<u> </u>		4
Aff.	Underseepage Relief Wells/Toe Drainage Systems	N/A N/A	-			-			
1000	Vegetation Growth	M M		-				-	
Levee Embankments - Other Items	Sod Cover	M							
ne i	Settlement	M							+
F E	Depressions/Rutting	M	i i						1
er	Cracking	Α	70						· •
e Embankme Other Items	Riprap Revetments & Bank Protection	M							
) vee	Revetments other than Riprap	N/A							
Le	Seepage	Α							
	Legend A Acceptable M Minimally Acceptable U Unacceptable N/A Not Applicable RP Rehabilitation Program (Note: flood fight as	M U U sistance availab	Includes Unacceptable observations not likely to prevent performance in next flow event Serious deficiency noted in past inspection report has not been corrected within established timeframe Likely prevents performance in next flood event ble regardless of eligibility status)						





Bear Creek - Units 7 West and 21

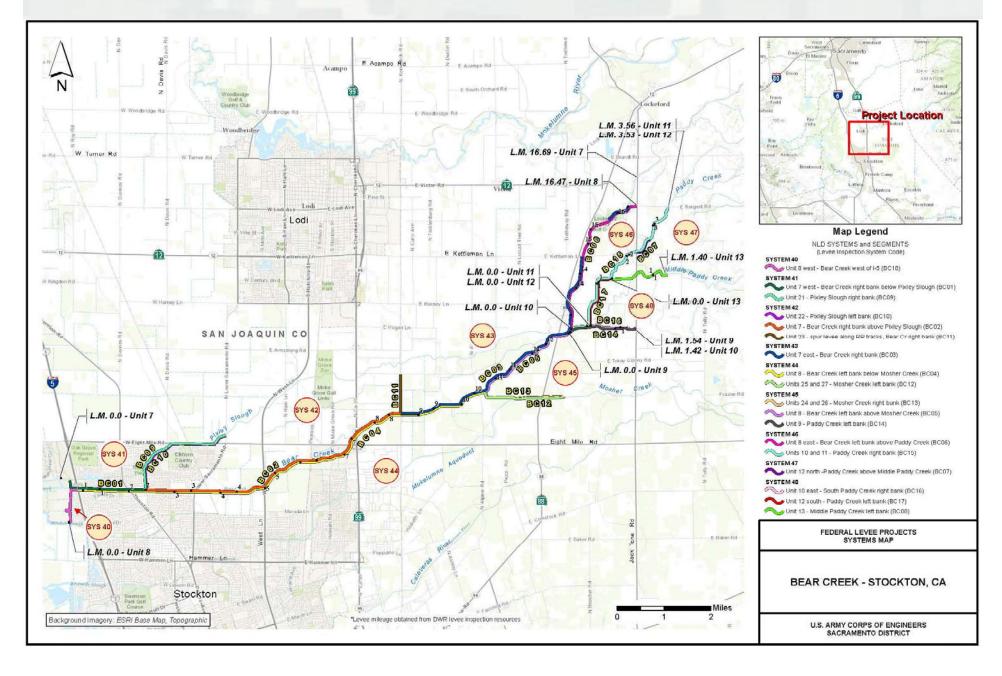

	System: Bear Creek-Units 7 West & 21 System Rating: Unacceptable Approved SWIF/LOI: No PL 84-99 RP Eligibility: Active	Juit Right Be	Sept Sept Sept Sept Sept Sept Sept Sept				
<u>'a</u>	Operations and Maintenance Manuals	M	M				
General	Emergency Supplies and Equipment	M	M				
g.	Flood Preparedness and Training	M	M				
КР	Encroachments	M	M				
sr 99	Closure Structures	N/A	N/A				
vee - Item ing PL 84- Eligibility	Slope Stability	M	M				
를 거 Idig	Erosion/Bank Caving	M	M				
Levee - Items Affecting PL 84-99 Eligibility	Animal Control	Α	A				
ed Le	Culverts/Discharge Pipes	N/A	N/A				
Aff	Underseepage Relief Wells/Toe Drainage Systems	N/A	N/A				
1	Vegetation Growth	M	M				
Levee Embankments - Other Items	Sod Cover	U	U				
ms m	Settlement	Α	A				
ank Ite	Depressions/Rutting	М	U				
e Embankme Other Items	Cracking	Α	U				
ot E	Riprap Revetments & Bank Protection	U	U				
eve	Revetments other than Riprap	N/A	N/A				
	Seepage	Α	A				
	<u>Legend</u> A Acceptable	М	Includes Unacceptable observations not likely to prevent performance in next flood event				
	M Minimally Acceptable	U	Serious deficiency noted in past inspection report has not been corrected within the established timeframe				
	U Unacceptable	U	Likely prevents performance in next flood event				
	N/A Not Applicable						
	RP Rehabilitation Program (Note: flood fight assis	stance available	e regardless of eligibility status)				

